


CURTIS 1264-5404/5405/5407

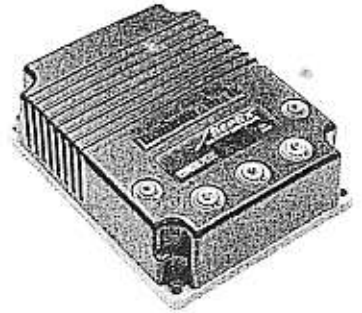


If installing this controller in an EZ-GO workhorse vehicle please follow the procedure below prior to installing this replacement controller.

The factory wire harness under the cart which leads to the key and F/R switch has a 3-way splice in it that has been found to become intermittent. This wiring problem will cause permanent damage to the motor controller left unrepaired.

Prior to installing a replacement controller remove the nylon cable shielding from the main controller harness, and locate the three wire splice found where the harness is routed under the vehicle. This connection must be re-terminated to ensure motor controller longevity. After these wires are fastened solidly wrap the harness with electrical tape or other means of wire protection.

Failure to not follow the above procedure will cause the controller to fail prematurely and warranty will not be honored.

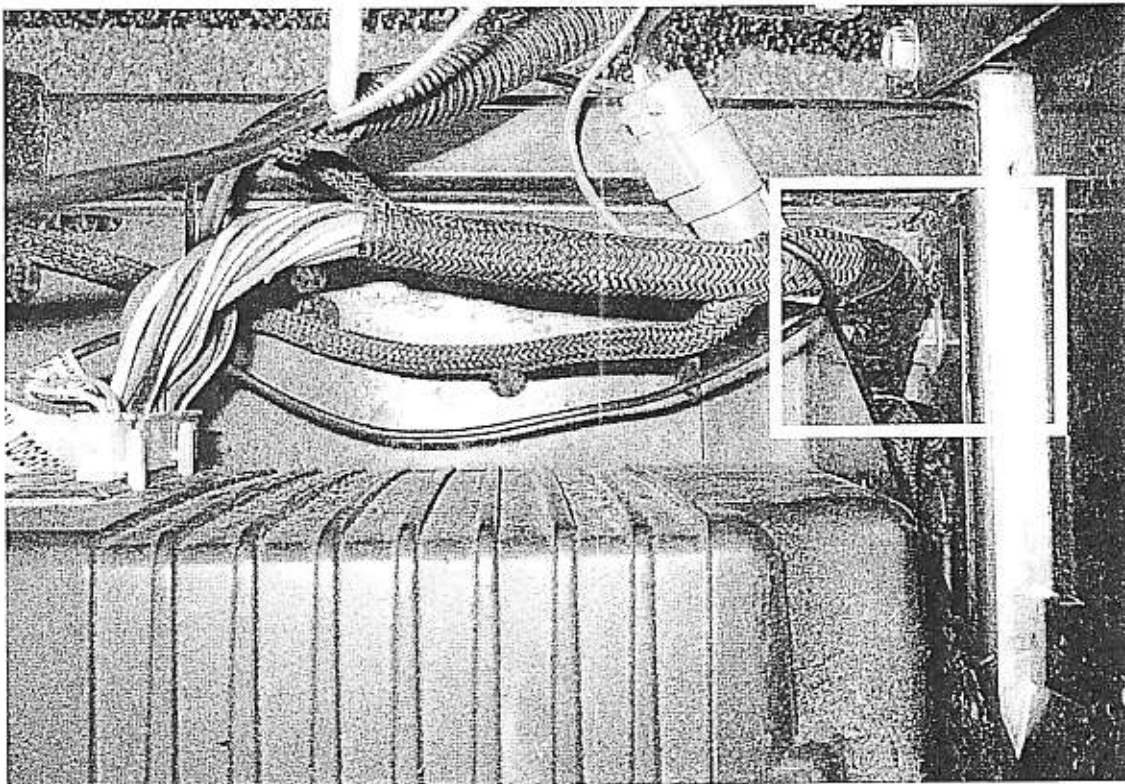

Revised: 3/15/2012

WPA 11/15
286-775-0539