

Volvo 641 & 295 Insert
M-MIS-90253

Attention!




Volvo Ignition Control Unit

If unit is intermittent or not working properly, check if **PIN CONTACT SLEEVES** are installed for proper connection.




Pin Contact Sleeve
Volvo Part Number:
1324909

Male Connector

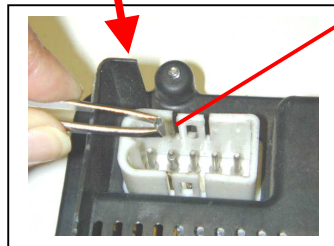

Female Connector

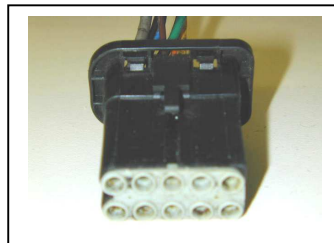

To replace or install Contact Sleeves, follow these instructions:

- 1- Clean old dirt (grease) from *female connector* and then apply new grease before plugging unit back for protection of the connectors.
- 2- Check to see if old PIN CONTACT SLEEVES are already in *female or male connector* from previous installation.
- 3- If PIN CONTACT SLEEVES were left on the old unit *male connector* remove them and reuse in the same position where they were taken off.
- 4- If PIN CONTACT SLEEVES are already in the *female connector*, you do not need to install new ones, but make sure each pin has one.
- 5- If PIN CONTACT SLEEVES are missing, you may order it from your nearest Volvo dealer. (see part number next to picture)